



## Technical Service BULLETIN

September 7, 2001

Title:

# TSB

### HIGH BEAM INDICATOR LIGHT INOPERATIVE

Models:

'01 Sequoia

EL007-01

ELECTRICAL

**Introduction** In rare cases, some owners of 2001 model year Sequoia vehicles equipped with Daytime Running Lights (DRLs) may experience a condition in which the High Beam Indicator Light does not illuminate when the high beams are turned on. A modification to the wiring harness and replacement of the Body ECU, as described below, should be performed to correct this condition.

**Applicable Vehicles**

- **2001** model year **Sequoia** vehicles with Daytime Running Lights (DRLs).

#### Production Change Information

MODEL	OPTION CODE	STARTING VIN
Sequoia	RL	5TD#T#8A#1S037964

#### Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME
89221-0C020	Same	Computer, Multiplex
N/A	90980-11918	Connector, 2-Pin

#### Warranty Information

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
EL1012	Modify Meter Circuit Wiring/R & R Body ECU	1.1	89221-0C020	72	99

#### Applicable Warranty\*:

This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.


\* Warranty application is limited to correction of a problem based upon a customer's specific complaint.




Toyota Supports ASE Certification

**Repair  
Procedure**

1. Modify the high beam indicator circuit wiring.
  - A. Remove the Combination Meter. See page BO–88 in the 2001 Sequoia Repair Manual.
  - B. Locate connector C7 at the back of the combination meter.
  - C. Remove pin 11 (red and green wire) from the back of the connector.

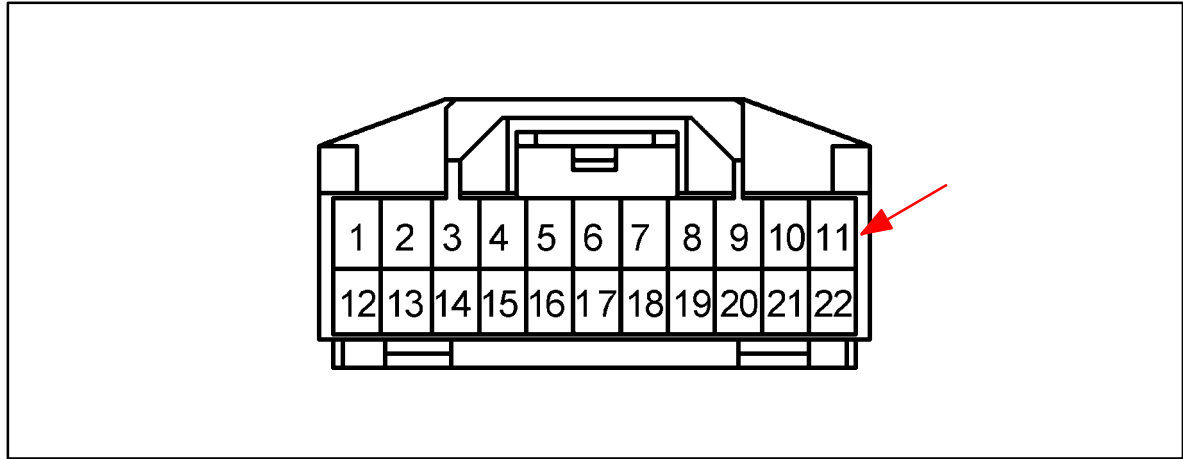

- D. To protect the terminal end, insert Pin 11 into the 2-pin connector (P/N 90980–11918) and verify pin tightness.
    - E. Tape the connector to the harness as shown below.

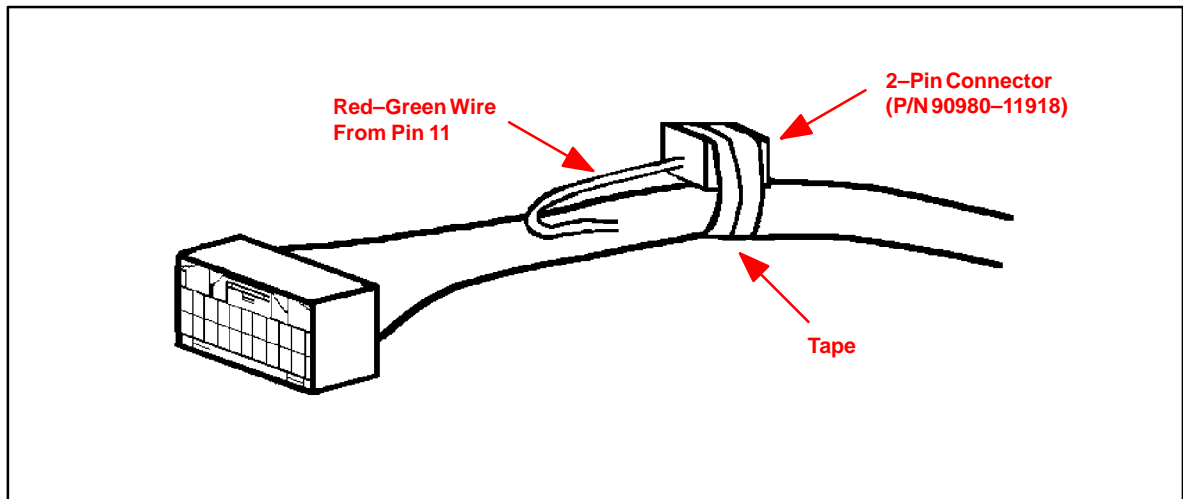

- F. Reinstall the combination meter.
2. Replace the Multiplex Computer (Body ECU), P/N 89221–OC020.
3. Verify proper system operation.